ID No. 00606	**Product/Process Change Notification**	Date 29.1.2019

Product	**Ordering Code**
L30960-N2720-A100	BGS5T USB
L30960-N2730-A100	EHS5T RS485
L30960-N2760-A100	EHS5T-US RS485
L30960-N2740-A100	EHS6T USB
L30960-N2751-A200	ELS61T_E2 LAN Rel.2
L30960-N2752-A100	ELS61T_US LAN
L30960-N2753-A100	ELS61T_AUS LAN
L30960-N2754-A100	ELS31T_V LAN
L30960-N2755-A100	ELS31_J LAN
L30960-N2770-A100	PLS62T_W USB
L30960-N2771-A100	PLS62T_W LAN
Ordering No. changes: ☐ Yes ☒ No	
New Ordering Code:	

Reason of Change:

☐ Technical requirement
☐ Customer requirement
☒ Quality improvement
☐ Change of production process/logistical changes
☐ Location of production moved
☐ Other:

Description of change:	As a general optimization of our terminals, to correct minor errors and to improve usability for our customers, the following four changes are being introduced to our terminal variants (where applicable) 1) AT^SPOW Set UART Mode and SLEEP Mode on UART: The power saver will be deactivated (UART always on), because typically, power is not a concern for the terminals, running off mains. The delivery default is now at^spow=1,0,0 instead of at^spow=2,1000,3 as it was before (but can be reset to this): ELS61T_E2 LAN Rel.2, ELS61T_US LAN, ELS61T_AUS LAN, ELS31T_V LAN, ELS31T_J LAN, PLS62T_W USB & LAN 2) Change label for US-capable variants: Remove "FCCID yyyy" for the terminal, list only module FCCID ("contains FCCID xxxx"), due to changed FCC requirements: ELS61T_US LAN, ELS31T_V LAN, PLS62T_W USB & LAN

	3) Changed housing: rename imprint ***GPS*** -> ***Ant*** on *all* terminals. Only 2 attachment holes on LAN variants, because of LAN part sitting there (also on PLS62T_W USB/LAN due to size): ELS61T_E2 LAN Rel.2, ELS61T_US LAN, ELS61T_AUS LAN, ELS31T_V LAN, ELS31T_J LAN, PLS62T_W USB & LAN 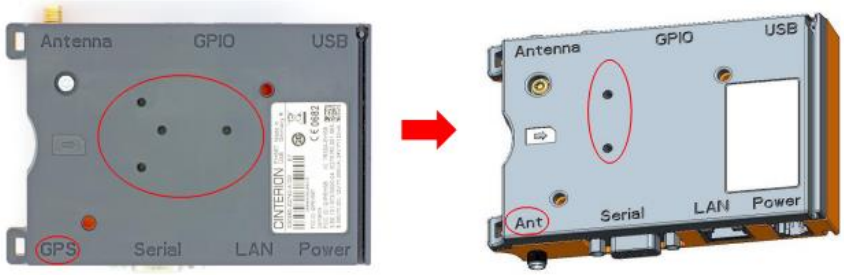 4) Housing of the power supply for terminals changed slightly, old adapters don't fit anymore. No ordering number change!
Scheduled date of introduction (cw/year):	Power Saver, Label change and power supply for deliveries from our warehouse from cw 09/2019. Changes in the housing imprint (GPS -> Ant) will gradually be phased in for all terminals, starting february 2019.
Timing note:	If Gemalto M2M GmbH does not receive a notification to the contrary within a period of 6 weeks, Gemalto M2M GmbH assumes that the customer agrees to the change.

Quality assurance measurements:	The new version fulfills all internal test requirements according to our Quality Management process and philosophy, and has obtained full type approval.

30.01.2019 2019/2/1

X Dr. Boris Siepert

Dr. Boris Siepert
PLM
Signed by: Boris Siepert 10015128

X Gu Yifeng

Gu Yi Feng
QM
Signed by: Yi Feng Gu 10015168

Attachments:

–