

1 Products affected

Product hierarchy no. *				Part no.	SBU	Type / Description	Customer part no.
SBU	PG	PGU	Type				
02	007	022	0000002056	See list below	Appliance Inlet	GSP2	

*SBU (2-digit) / PG (3-digit) / PGU (3-digit) / Type (10-digit)

List of part numbers affected							
GSP2.000H.13	GSP2.6100.14	GSP2.7201.11	GSP2.7901.16	GSP2.8001.13	GSP2.8003.13	GSP2.8100.15	GSP2.8101.13
GSP2.8103.13	GSP2.810C.13	GSP2.810E.13	GSP2.8111.11	GSP2.8111.13	GSP2.8113.11	GSP2.8113.13	GSP2.8200.15
GSP2.8201.11	GSP2.8201.13	GSP2.8201.15	GSP2.8203.13	GSP2.8203.15	GSP2.820C.13	GSP2.820E.13	GSP2.8211.13
GSP2.8211.15	GSP2.8213.13	GSP2.8901.13	GSP2.8903.13	GSP2.8915.13	GSP2.9001.13	GSP2.9003.13	GSP2.9100.13
GSP2.9100.14	GSP2.9100.15	GSP2.9100.16	GSP2.9101.13	GSP2.9103.11	GSP2.9103.13	GSP2.9103.14	GSP2.9103.15
GSP2.9103.16	GSP2.910E.13	GSP2.910E.16	GSP2.9110.13	GSP2.9110.14	GSP2.9110.15	GSP2.9110.16	GSP2.9111.13
GSP2.9113.13	GSP2.9113.14	GSP2.9113.15	GSP2.9113.16	GSP2.911C.13	GSP2.911E.16	GSP2.9200.13	GSP2.9200.14
GSP2.9200.15	GSP2.9200.16	GSP2.9200.1601	GSP2.9201.13	GSP2.9201.16	GSP2.9203.11	GSP2.9203.12	GSP2.9203.13
GSP2.9203.1322	GSP2.9203.14	GSP2.9203.15	GSP2.9203.16	GSP2.9203.1602	GSP2.9205.13	GSP2.920A.13	GSP2.9210.13
GSP2.9210.14	GSP2.9210.15	GSP2.9210.16	GSP2.9211.13	GSP2.9213.13	GSP2.9213.1322	GSP2.9213.14	GSP2.9213.15
GSP2.9213.16	GSP2.9901.13	GSP2.9903.13					

2 Type of change

Change of material, V-Lock cord retaining feature as standard.


3 Detailed description of change

- Material change from PA6 to PA66/6 to pass the enhanced requirements of glow wire test acc. to IEC 60695-2-12 and -13
- V-Lock feature integrated as standard (not an option anymore)
- Radius on the front frame reduced from 2.0 to 1.0 mm

Old



New with V-Lock

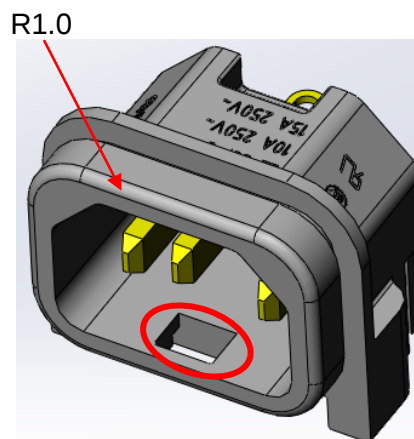

As the V-Lock and material for enhanced glow wire tests are standard features now, the material numbers with index .15, .21 und .23 are obsolete and will be replaced by the standard numbers:

GSP2.9103.1315	⇒	GSP2.9103.13	GSP2.9200.1323	⇒	GSP2.9200.13
GSP2.9103.1321	⇒	GSP2.9103.13	GSP2.9203.1615	⇒	GSP2.9203.16
GSP2.9103.1323	⇒	GSP2.9103.13	GSP2.9213.1315	⇒	GSP2.9213.13
GSP2.9103.1421	⇒	GSP2.9103.14	GSP2.9213.1321	⇒	GSP2.9213.13
GSP2.9200.1315	⇒	GSP2.9200.13			

Product Change Notification					PCN GSP2 Appliance Inlet		
owner	creation date	release date	released by	change order no	rev	page	0118.2289
import	2015-12-05	2016-01-04	hotzar	2008799	A	1 of 2	

4 Reason of change

- Change of material
- V-Lock feature implemented as a standard feature.

5 Release date

The change will be rolled-out starting ww 05/2016 (Date code 1605 or higher on label) and lasts approx. to 30/2016 depending on the variant.

6 Impact of change and recommended action

Form: Yes Socket has notch for V-Lock cord retaining and Radius on the front frame reduced from 2.0 to 1.0 mm
 Fit: No There are no dimensional changes
 Function: Yes V-Lock feature is standard (not an option anymore)
 Production Site: No There is no change of the production site
 Product Label: No No label change

7 Reference Documents / Attachments

Kind of document	Document number	Remarks
GSP2 Data sheet		

Product Change Notification					PCN GSP2 Appliance Inlet		
owner	creation date	release date	released by	change order no	rev	page	0118.2289
import	2015-12-05	2016-01-04	hotzar	2008799	A	2 of 2	