

**1 Products affected**

Product hierarchy no. *				Part no.	SBU	Type / Description	Customer part no.
SBU	PG	PUG	Type				
02	005	016	0000001105	See list below	Power Entry Modules w/o Filter	6205	

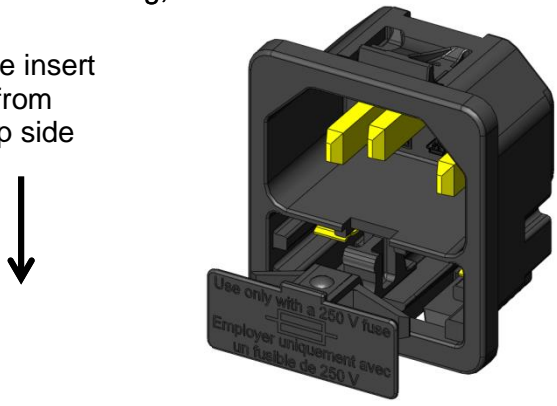
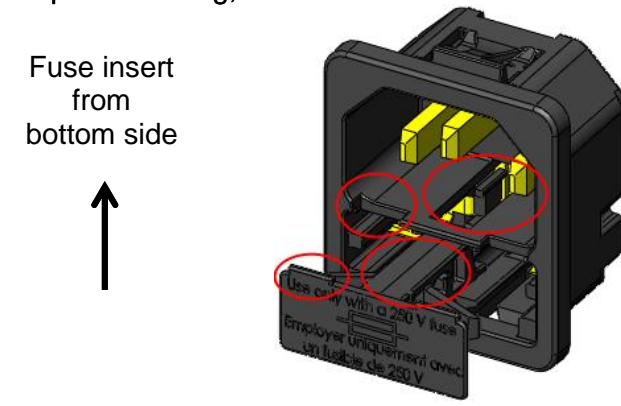
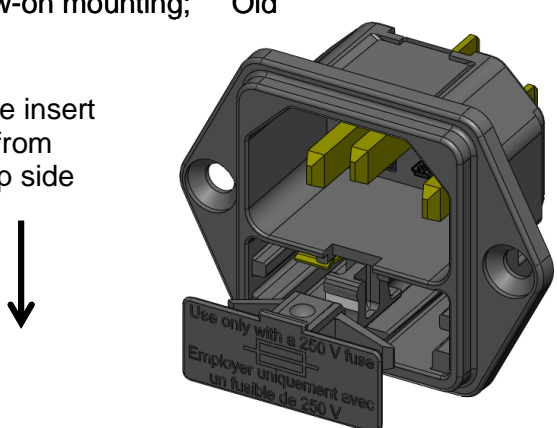
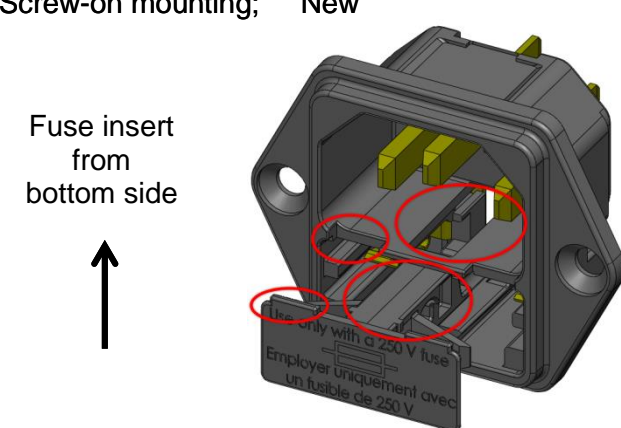
\*SBU (2-digit) / PG (3-digit) / PUG (3-digit) / Type (10-digit)

List of part numbers affected				
6205.2100	6205.2200	6205.2300	6205.4110	6205.4112
6205.4115	6205.4120	6205.4215	6205.4220	6205.4230
6205.4310	6205.4312	6205.4315	6205.4320	6205.4325
6205.4330				

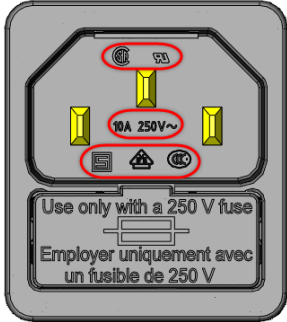
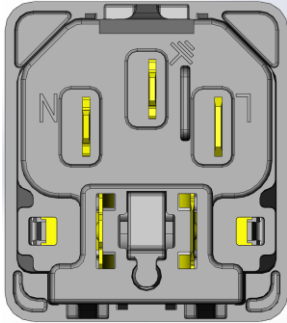

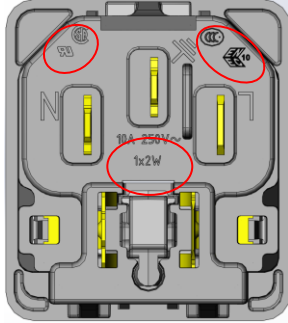
**2 Type of change**

1. V-Lock cord retaining integrated as standard
2. Material change
3. Modification of approval marks

**3 Detailed description of change**

Old product appearance		New product appearance	
<ul style="list-style-type: none"> <li>- Slot for V-Lock cord retention</li> <li>- Fuse assembling from opposite side</li> <li>- Fusedrawer has two latches on the side to pull-out the fusedrawer, until now is only one latch</li> </ul>			
<p>Snap-in mounting; Old</p> <p>Fuse insert from top side</p> 	<p>Snap-in mounting; New</p> <p>Fuse insert from bottom side</p> 		
<p>Screw-on mounting; Old</p> <p>Fuse insert from top side</p> 	<p>Screw-on mounting; New</p> <p>Fuse insert from bottom side</p> 		

Product Change Notification					PCN 6205		
owner	creation date	release date	released by	change order no	rev	page	D10-007-429
schaidro	2016-08-24	2016-12-06	buerglal	2011605	A	1 of 2	

Old product approval marks	New product approval marks
Picture shows snap-in mounting, change also applies to screw version. All approval and rating marks are new on the rear side	
<p>Old;</p>  	<p>New;</p>  

#### 4 Reason of change

- V-Lock cord retaining implemented as a standard feature
- VDE mark replaced by ENEC10
- Product improvement to fulfil the enhanced glow wire requirements according to the updated standard IEC 60127-6 and the standard IEC 60335-1 for appliances in unattended use.

#### 5 Release date

The change will be rolled-out starting ww 43/2016 and lasts approx. 8 months depending on the variant.

#### 6 Impact of change and recommended action

Form	Yes	- Slot (notch) for V-Lock cord retention - Insertion of the fuse is changed to bottom side - Fusedrawer has 2 latches sideways
Fit	No	No dimensional change
Function	Yes	Compatible with V-Lock cordsets
Production Site	No	No change of the production site
Product Label	Yes	VDE mark replaced by ENEC10
Customer Action	No	Notification only

#### 7 Reference Documents / Attachments

Kind of document	Remarks
<a href="#">6205</a>	Datasheet

Product Change Notification					PCN 6205		
owner	creation date	release date	released by	change order no	rev	page	D10-007-429
schaidro	2016-08-24	2016-12-06	buerglal	2011605	A	2 of 2	